

7001 Merion Drive
4611
Nixa MO 65714

Telephone 417-725-

Fax 417-724-0655

**TO: Chris Edwards, Building Development Services
City of Springfield**
FROM: Scott Mills, Security Storage Service
DATE: July 5, 2017.
SUBJECT: Asbestos Inspection Summary

Attached are the inspection reports for:

1401 N. Ethyl	1360 sq. ft. exterior transite
806 N. Grant	200 sq. ft. ceiling texture
1162 W. Hovey	875 sq. ft. exterior transite
1820 N. Drury	None
1150 W. Hovey	None

Please let me know if anything else needed.

We appreciate the opportunity to be of service.

Sincerely,

Scott Mills
Security Storage Service

Security Storage Service, Inc.

7021 Merion Drive
Nixa MO 65714

Telephone 417-725-4611

July 5, 2017

Building Development Services
Attn: Christi Edwards
840 Boonville Ave.
Springfield MO 65802

Dear Sirs:

Pursuant to our agreement and instructions, an asbestos inspection of **the residential structure located at 1401 North Ethyl, Springfield, Missouri**, was completed on **June 15, 2017**. The inspector was Dustin Garges, Cert.# 7034122816 MOIR16385. The inspection included observation and bulk sampling of areas and materials suspected to have asbestos content. Samples taken were referred to SanAir Technologies Laboratory, a nationally accredited laboratory for analysis. Chain of custody documentation was preserved.

Observation and sampling was limited to areas of the property, which were visible and accessible during normal usage of the building. Should additional areas or materials, which might be suspect, become exposed during demolition, renovation, or alteration, we will return to inspect these as desired.

Of the materials observed and sampled at this location, **no items were tested to be positive for asbestos. The exterior transite siding (app. 1360 ft²): however, under metal covering, should be assumed to be POSITIVE for asbestos content**

This assessment was conducted by an AHERA and Missouri certified asbestos inspector. Conclusions contained herein are based solely upon the described scope of work in this Security Storage Service's proposal and inspection of the described areas. No opinion, expressed or implied, is made as to the presence or absence of asbestos and areas of the site not accessible and/or not included in the scope of this inspection. There are many situations where ACM may be concealed and accessible areas. When the series, become exposed during construction, remodeling, or demolition, such material should either be sampled or treated is assumed asbestos-containing. Further inspection may be warranted as areas are exposed during such activities. This report has been prepared for the client designated above is not for use of other parties without the express consent of the client

We appreciate the opportunity to be of service.

Sincerely,

A handwritten signature in black ink, appearing to read 'D. Garges', with a long horizontal flourish extending to the right.

Dustin Garges
Security Storage Service

Security Storage Service, Inc.

7001 Merion Drive
Nixa-Fremont Hills MO 65714

Telephone 417-725-4611
Fax 417-724-0655

July 5, 2017

SAMPLING CHECKLIST

Location: 1401 North Ethyl, Springfield, MO

Date: June 15, 2017

Client: City of Springfield


Exterior Description: Residential structure with a shingle roof; metal over **transite** walls; wood flooring; fiberglass insulation.

Interior Description: Textured sheetrock ceilings; sheetrock walls; linoleum, concrete, and wood floors; central HVAC

The following samples were taken to determine the presence of asbestos:

Sample #	Material/Location	Result
1401E001	"Popcorn" ceiling texture, kitchen	Negative
1401E002	"Popcorn" ceiling texture, living room	Negative
1401E003	"Popcorn" ceiling texture, bathroom	Negative
1401E004	Linoleum flooring, furnace room	Negative
1401E004	Mastic adhering to furnace room linoleum	Negative
1401E005	Sheetrock wall material, living room	Negative

Lab report follows

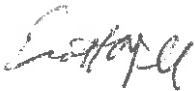

Scott Mills
Security Storage Service



SanAir Technologies Laboratory, Inc.

1551 Oakbridge Drive, Suite B, Powhatan, VA 23139
804.897.1177 Toll Free: 888.895.1177 Fax: 804.897.0070
Web: <http://www.sanair.com> E-mail: iaq@sanair.com

SanAir ID Number

17023402

FINAL REPORT

Name: Security Storage Services Inc.
Address: 7001 Merion Dr
Nixa, MO 65714

Project Number:
P.O. Number:
Project Name: City Of Spfd

Collected Date: 6/15/2017
Received Date: 6/22/2017 10:30:00 AM
Report Date: 6/26/2017 10:12:53 AM
Analyst: Rouillard, Elliott

Asbestos Bulk PLM EPA 600/R-93/116

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1401E001 / 17023402-001 1401 N. Ethyl Spfd, MO	Off-White Non-Fibrous Heterogeneous	3% Cellulose	97% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1401E002 / 17023402-002 1401 N. Ethyl Spfd, MO	Off-White Non-Fibrous Heterogeneous	3% Cellulose	97% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1401E003 / 17023402-003 1401 N. Ethyl Spfd, MO	Off-White Non-Fibrous Heterogeneous	3% Cellulose	97% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1401E004 / 17023402-004 1401 N. Ethyl Spfd, MO, Linoleum	Various Non-Fibrous Heterogeneous	30% Cellulose 5% Glass	65% Other	None Detected
1401E004 / 17023402-004 1401 N. Ethyl Spfd, MO, Mastic	Brown Non-Fibrous Homogeneous		100% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1401E005 / 17023402-005 1401 N. Ethyl Spfd, MO	White Non-Fibrous Heterogeneous	3% Cellulose	97% Other	None Detected

Certification

Analyst: *Elliott Rouillard*
Analysis Date: 6/26/2017

Approved Signatory: *[Signature]*
Date: 6/26/2017

Expiration Date **1/24/2018**

Certificate Number: 7034122816MOIR16385

Training Date: **12/28/2016**

Missouri State Certificate for Asbestos Related Occupations

issued by Department of Natural Resources

P.O. Box 176

Jefferson City, MO 65102

Phone (573) 751-4817

Dustin L Garges


has successfully completed the requirements for certification as a INSPECTOR. This Missouri State Certification is subject to review and the director may deny, suspend or revoke the certification per RSMo chapter 643.230.

1/24/2017

Date

Kyra L Moore

Director of Air Pollution Control Program

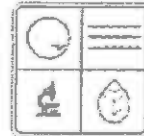

CERTIFICATION
NUMBER: **7034122816MOIR16385**

THIS CERTIFIES
Dustin L Garges

HAS COMPLETED THE CERTIFICATION
REQUIREMENTS FOR
Inspector



APPROVED: **1/24/2017**

TRAINING DATE **12/28/2016**

EXPIRES: **1/24/2018**

Kyra L Moore
Director of Air Pollution Control Program

Security Storage Service, Inc.

7001 Merion Drive
Nixa MO 65714

Telephone 417-725-4611

July 5, 2017

Building Development Services
Attn: Christi Edwards
840 Boonville Ave.
Springfield MO 65802

Dear Sirs:

Pursuant to our agreement and instructions, an asbestos inspection of **the accessory structure (single story apartment) located at 806 North Grant, Springfield, Missouri**, was completed on **June 15, 2017**. The inspector was Dustin Garges, Cert.# 7034122816 MOIR16385. The inspection included observation and bulk sampling of areas and materials suspected to have asbestos content. Samples taken were referred to SanAir Technologies Laboratory, a nationally accredited laboratory for analysis. Chain of custody documentation was preserved.

Observation and sampling was limited to areas of the property, which were visible and accessible during normal usage of the building. Should additional areas or materials, which might be suspect, become exposed during demolition, renovation, or alteration, we will return to inspect these as desired.

Of the materials observed and sampled at this location, **only the ceiling texture material (app. 200 ft²) tested POSITIVE for asbestos. The flooring materials were not available for testing due to the large quantity of trash and debris present.**

This assessment was conducted by an AHERA and Missouri certified asbestos inspector. Conclusions contained herein are based solely upon the described scope of work in this Security Storage Service's proposal and inspection of the described areas. No opinion, expressed or implied, is made as to the presence or absence of asbestos and areas of the site not accessible and/or not included in the scope of this inspection. There are many situations where ACM may be concealed and accessible areas. When the series, become exposed during construction, remodeling, or demolition, such material should either be sampled or treated is assumed asbestos-containing. Further inspection may be warranted as areas are exposed during such activities. This report has been prepared for the client designated above is not for use of other parties without the express consent of the client

We appreciate the opportunity to be of service.

Sincerely,

A handwritten signature in black ink, appearing to read 'Dustin Garges', with a long horizontal flourish extending to the right.

Dustin Garges
Security Storage Service

Security Storage Service, Inc.

7001 Merion Drive
Nixa-Fremont Hills MO 65714

Telephone 417-725-4611
Fax 417-724-0655

July 5, 2017

SAMPLING CHECKLIST

Location: 806 North Grant, Springfield, MO

Date: June 15, 2017

Client: City of Springfield

Exterior Description: Residential apartment accessory structure with a shingle roof; wood walls; concrete flooring; fiberglass insulation.

Interior Description: Textured sheetrock and tile ceilings; sheetrock walls; linoleum, concrete, and debris covered floors; missing HVAC

The following samples were taken to determine the presence of asbestos:

Sample #	Material/Location	Result
806G001	Sheetrock wall material	Negative
806G002	12" ceiling tile, throughout	Negative
806G003	Ceiling texture material, throughout, (app 200 ft ²)	POSITIVE-3%
806G004	Ceiling texture material, upper layer,	Negative
806G004	Ceiling texture material, texture layer	POSITIVE-4%

Lab report follows



Scott Mills
Security Storage Service



SanAir Technologies Laboratory, Inc.

1551 Oakbridge Drive, Suite B, Powhatan, VA 23139
804.897.1177 Toll Free: 888.895.1177 Fax: 804.897.0070
Web: <http://www.sanair.com> E-mail: iaq@sanair.com

SanAir ID Number

17023403

FINAL REPORT

Name: Security Storage Services Inc.
Address: 7001 Merion Dr
Nixa, MO 65714

Project Number:
P.O. Number:
Project Name: City Of Spfd

Collected Date: 6/15/2017
Received Date: 6/22/2017 10:30:00 AM
Report Date: 6/26/2017 10:21:34 AM
Analyst: Robertson, Erin

Asbestos Bulk PLM EPA 600/R-93/116

SanAir ID / Description	Stereoscopic Appearance	% Fibrous	Components % Non-Fibrous	Asbestos Fibers
806G001 / 17023403-001 806 N. Grant Spfd, MO	Off-White Non-Fibrous Homogeneous	10%	Cellulose 90% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	% Fibrous	Components % Non-Fibrous	Asbestos Fibers
806G002 / 17023403-002 806 N. Grant Spfd, MO	White Fibrous Homogeneous	95%	Cellulose 5% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	% Fibrous	Components % Non-Fibrous	Asbestos Fibers
806G003 / 17023403-003 806 N. Grant Spfd, MO	Off-White Non-Fibrous Homogeneous	5%	Wollastonite 92% Other	3% Chrysotile

SanAir ID / Description	Stereoscopic Appearance	% Fibrous	Components % Non-Fibrous	Asbestos Fibers
806G004 / 17023403-004 806 N. Grant Spfd, MO, Drywall	Off-White Non-Fibrous Homogeneous	5%	Cellulose 95% Other	None Detected
806G004 / 17023403-004 806 N. Grant Spfd, MO, Texture	Off-White Non-Fibrous Homogeneous	3%	Wollastonite 93% Other	4% Chrysotile

Certification

Analyst: *Erin Robertson*
Analysis Date: 6/26/2017

Approved Signatory: *[Signature]*
Date: 6/26/2017

Expiration Date **1/24/2018**

Certificate Number: 7034122816MOIR16385

Training Date: **12/28/2016**

Missouri State Certificate for Asbestos Related Occupations

issued by Department of Natural Resources

P.O. Box 176

Jefferson City, MO 65102

Phone (573) 751-4817

Dustin L Garges


has successfully completed the requirements for certification as a INSPECTOR. This Missouri State Certification is subject to review and the director may deny, suspend or revoke the certification per RSMo chapter 643.230.

1/24/2017

Date

Kyra L Moore

Director of Air Pollution Control Program

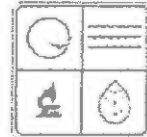

CERTIFICATION
NUMBER: **7034122816MOIR16385**

THIS CERTIFIES
Dustin L Garges

HAS COMPLETED THE CERTIFICATION
REQUIREMENTS FOR
Inspector



APPROVED: **1/24/2017**

TRAINING DATE **12/28/2016**

EXPIRES: **1/24/2018**

Kyra L Moore
Director of Air Pollution Control Program

Security Storage Service, Inc.

7001 Merion Drive
Nixa MO 65714

Telephone 417-725-4611

July 5, 2017

Building Development Services
Attn: Christi Edwards
840 Boonville Ave.
Springfield MO 65802

Dear Sirs:

Pursuant to our agreement and instructions, an asbestos inspection of **the residential structure located at 1162 West Hovey, Springfield, Missouri**, was completed on **June 15, 2017**. The inspector was Dustin Garges, Cert.# 7034122816 MOIR16385. The inspection included observation and bulk sampling of areas and materials suspected to have asbestos content. Samples taken were referred to SanAir Technologies Laboratory, a nationally accredited laboratory for analysis. Chain of custody documentation was preserved.

Observation and sampling was limited to areas of the property, which were visible and accessible during normal usage of the building. Should additional areas or materials, which might be suspect, become exposed during demolition, renovation, or alteration, we will return to inspect these as desired.

Of the materials observed and sampled at this location, **no items tested positive for asbestos. The exterior transite siding (app. 875 ft²); however, should be assumed to be POSITIVE for asbestos content.**

This assessment was conducted by an AHERA and Missouri certified asbestos inspector. Conclusions contained herein are based solely upon the described scope of work in this Security Storage Service's proposal and inspection of the described areas. No opinion, expressed or implied, is made as to the presence or absence of asbestos and areas of the site not accessible and/or not included in the scope of this inspection. There are many situations where ACM may be concealed and accessible areas. When the series, become exposed during construction, remodeling, or demolition, such material should either be sampled or treated is assumed asbestos-containing. Further inspection may be warranted as areas are exposed during such activities. This report has been prepared for the client designated above is not for use of other parties without the express consent of the client

We appreciate the opportunity to be of service.

Sincerely,

A handwritten signature in black ink, appearing to read "D. Garges", with a long horizontal flourish extending to the right.

Dustin Garges
Security Storage Service

Security Storage Service, Inc.

7001 Merion Drive
Nixa-Fremont Hills MO 65714

Telephone 417-725-4611
Fax 417-724-0655

July 5, 2017

SAMPLING CHECKLIST

Location: 1162 West Hovey, Springfield, MO

Date: June 15, 2017

Client: City of Springfield

Exterior Description: Residential structure with a shingle roof; **transite** walls; wood flooring; fiberglass insulation.


Interior Description: Plaster ceilings; plaster walls; wood and tile floors; central HVAC

The following samples were taken to determine the presence of asbestos:

Sample #	Material/Location	Result
1162H001	12" Floor tile, bath & hallway (60 ft ²)	POSITIVE-2%
1162H001	Mastic adhering to bath & hallway floor tile	Negative
1162H002	Plaster, interior walls and ceilings	Negative
1162H002	Plaster, skim coat	Negative
1162H003	Plaster, interior walls and ceilings	Negative
1162H003	Plaster, skim coat	Negative

Note: The exterior plaster siding should be assumed to be POSITIVE for asbestos.

Lab report follows

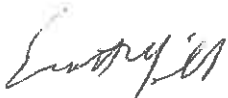

Scott Mills
Security Storage Service



SanAir Technologies Laboratory, Inc.

1551 Oakbridge Drive, Suite B, Powhatan, VA 23139
804.897.1177 Toll Free: 888.895.1177 Fax: 804.897.0070
Web: <http://www.sanair.com> E-mail: iaq@sanair.com

SanAir ID Number

17023400

FINAL REPORT

Name: Security Storage Services Inc.
Address: 7001 Merion Dr
Nixa, MO 65714

Project Number:
P.O. Number:
Project Name: City Of Spfd

Collected Date: 6/15/2017
Received Date: 6/22/2017 10:30:00 AM
Report Date: 6/26/2017 10:59:46 AM
Analyst: Childress, Susan

Asbestos Bulk PLM EPA 600/R-93/116

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1162H001 / 17023400-001 1162 W. Hovey Spfd, MO, Floor Tile	Off-White Non-Fibrous Homogeneous		98% Other	2% Chrysotile
1162H001 / 17023400-001 1162 W. Hovey Spfd, MO, Mastic	Black Non-Fibrous Homogeneous	3% Cellulose	97% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1162H002 / 17023400-002 1162 W. Hovey Spfd, MO, Plaster	Beige Non-Fibrous Homogeneous	< 1% Cellulose	100% Other	None Detected
1162H002 / 17023400-002 1162 W. Hovey Spfd, MO, Skim Coat	White Non-Fibrous Homogeneous		100% Other	None Detected

SanAir ID / Description	Stereoscopic Appearance	Components		Asbestos Fibers
		% Fibrous	% Non-Fibrous	
1162H003 / 17023400-003 1162 W. Hovey Spfd, MO, Plaster	Beige Non-Fibrous Homogeneous	< 1% Cellulose	100% Other	None Detected
1162H003 / 17023400-003 1162 W. Hovey Spfd, MO, Skim Coat	White Non-Fibrous Homogeneous		100% Other	None Detected

Certification

Analyst: *Susan Childress*
Analysis Date: 6/26/2017

Approved Signatory: *[Signature]*
Date: 6/26/2017

Expiration Date **1/24/2018**

Certificate Number: 7034122816MOIR16385

Training Date: **12/28/2016**

Missouri State Certificate for Asbestos Related Occupations

issued by Department of Natural Resources

P.O. Box 176

Jefferson City, MO 65102

Phone (573) 751-4817

Dustin L Garges


has successfully completed the requirements for certification as a INSPECTOR. This Missouri State Certification is subject to review and the director may deny, suspend or revoke the certification per RSMo chapter 643.230.

1/24/2017

Date

Kyra L Thorne

Director of Air Pollution Control Program

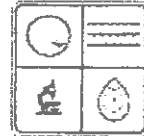

CERTIFICATION
NUMBER: **7034122816MOIR16385**

THIS CERTIFIES
Dustin L Garges

HAS COMPLETED THE CERTIFICATION
REQUIREMENTS FOR
Inspector



APPROVED: **1/24/2017**

TRAINING DATE **12/28/2016**

EXPIRES: **1/24/2018**

Kyra L Thorne
Director of Air Pollution Control Program

Security Storage Service, Inc.

7001 Merion Drive
Nixa MO 65714

Telephone 417-725-4611

July 5, 2017

Building Development Services
Attn: Christi Edwards
840 Boonville Ave.
Springfield MO 65802

Dear Sirs:

Pursuant to our agreement and instructions, an asbestos inspection of **the accessory structure located at 1150 West Hovey, Springfield, Missouri**, was completed on **June 15, 2017**. The inspector was Dustin Garges, Cert.# 7034122816 MOIR16385. The inspection included observation and bulk sampling of areas and materials suspected to have asbestos content. Samples taken were referred to SanAir Technologies Laboratory, a nationally accredited laboratory for analysis. Chain of custody documentation was preserved.

Observation and sampling was limited to areas of the property, which were visible and accessible during normal usage of the building. Should additional areas or materials, which might be suspect, become exposed during demolition, renovation, or alteration, we will return to inspect these as desired.

This was an accessory structure with a shingle roof, wood walls and dirt flooring, partially collapsed. Of the materials observed and sampled at this location **no items were found to be suspect for asbestos content.**

This assessment was conducted by an AHERA and Missouri certified asbestos inspector. Conclusions contained herein are based solely upon the described scope of work in this Security Storage Service's proposal and inspection of the described areas. No opinion, expressed or implied, is made as to the presence or absence of asbestos and areas of the site not accessible and/or not included in the scope of this inspection. There are many situations where ACM may be concealed and accessible areas. When the series, become exposed during construction, remodeling, or demolition, such material should either be sampled or treated is assumed asbestos-containing. Further inspection may be warranted as areas are exposed during such activities. This report has been prepared for the client designated above is not for use of other parties without the express consent of the client

We appreciate the opportunity to be of service.

Sincerely,

A handwritten signature in black ink, appearing to read 'Dustin Garges', with a long horizontal flourish extending to the right.

Dustin Garges
Security Storage Service

Expiration Date **1/24/2018**
Training Date: **12/28/2016**

Certificate Number: 7034122816MOIR16385

Missouri State Certificate for Asbestos Related Occupations

issued by Department of Natural Resources

P.O. Box 176
Jefferson City, MO 65102
Phone (573) 751-4817

Dustin L Garges


has successfully completed the requirements for certification as a INSPECTOR. This Missouri State Certification is subject to review and the director may deny, suspend or revoke the certification per RSMo chapter 643.230.

1/24/2017

Date

Kyra L Moore

Director of Air Pollution Control Program

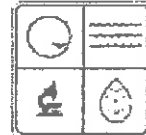

CERTIFICATION
NUMBER: **7034122816MOIR16385**

THIS CERTIFIES
Dustin L Garges

HAS COMPLETED THE CERTIFICATION
REQUIREMENTS FOR
Inspector



APPROVED: **1/24/2017**

TRAINING DATE **12/28/2016**

EXPIRES: **1/24/2018**

Kyra L Moore
Director of Air Pollution Control Program

Security Storage Service, Inc.

7001 Merion Drive
Nixa MO 65714

Telephone 417-725-4611

July 5, 2017

Building Development Services
Attn: Christi Edwards
840 Boonville Ave.
Springfield MO 65802

Dear Sirs:

Pursuant to our agreement and instructions, an asbestos inspection of **the residential structure located at 1820 North Drury, Springfield, Missouri**, was completed on **June 15, 2017**. The inspector was Dustin Garges, Cert.# 7034122816 MOIR16385. The inspection included observation and bulk sampling of areas and materials suspected to have asbestos content. Samples taken were referred to SanAir Technologies Laboratory, a nationally accredited laboratory for analysis. Chain of custody documentation was preserved.

Observation and sampling was limited to areas of the property, which were visible and accessible during normal usage of the building. Should additional areas or materials, which might be suspect, become exposed during demolition, renovation, or alteration, we will return to inspect these as desired.

Of the materials observed and sampled at this location, which has been severely fire damaged, most areas of the building were inaccessible. The building is deemed unsafe to enter, and no remaining items were suspect for asbestos content.

This assessment was conducted by an AHERA and Missouri certified asbestos inspector. Conclusions contained herein are based solely upon the described scope of work in this Security Storage Service's proposal and inspection of the described areas. No opinion, expressed or implied, is made as to the presence or absence of asbestos and areas of the site not accessible and/or not included in the scope of this inspection. There are many situations where ACM may be concealed and accessible areas. When the series, become exposed during construction, remodeling, or demolition, such material should either be sampled or treated is assumed asbestos-containing. Further inspection may be warranted as areas are exposed during such activities. This report has been prepared for the client designated above is not for use of other parties without the express consent of the client

We appreciate the opportunity to be of service.

Sincerely,

A handwritten signature in black ink, appearing to read 'Dustin Garges', with a long horizontal flourish extending to the right.

Dustin Garges
Security Storage Service

Expiration Date **1/24/2018**

Certificate Number: 7034122816MOIR16385

Training Date: **12/28/2016**

Missouri State Certificate for Asbestos Related Occupations

issued by Department of Natural Resources

P.O. Box 176

Jefferson City, MO 65102

Phone (573) 751-4817

Dustin L Garges


has successfully completed the requirements for certification as a INSPECTOR. This Missouri State Certification is subject to review and the director may deny, suspend or revoke the certification per RSMo chapter 643.230.

1/24/2017

Date

Kyra L Moore

Director of Air Pollution Control Program

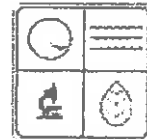

CERTIFICATION
NUMBER: **7034122816MOIR16385**

THIS CERTIFIES
Dustin L Garges

HAS COMPLETED THE CERTIFICATION
REQUIREMENTS FOR
Inspector



APPROVED: **1/24/2017**

TRAINING DATE **12/28/2016**

EXPIRES: **1/24/2018**

Kyra L Moore
Director of Air Pollution Control Program